

## Buyers Guide to:

# Volkswagen Type 2 Bay Window

#### **Useful Info**

Also Known As Type 2 (T2), Bay, Early Bay, Late Bay, Kombi, T2B

Manufactured 1967 to 1979

Fuel Type Petrol **Engine Sizes** 

1600cc, 1700cc, 1800cc, 2000cc

**Engine Type** Air-Cooled

**Drive Configuration** 

Volkswagen Owners Club of Great Britain

www.vwocgb.com

Volkswagen Type 2 Owners Club

www.vwt2oc.co.uk

**Just Kampers** 

Odiham, Hampshire, RG29 1JE 01256 862288 www.iustkampers.com



#### **Background**

Bigger and heavier than the original, the development of the Volkswagen Type 2 became the 'Bay Window' model. Losing the split screen front end, it arrived in 1968 and benefitted from a number of improvements including independent rear suspension in place of the previous swing-axles. Engines were larger, ranging from a 47bhp 1.6 to a 2.0-litre with 68bhp, while developments over the years included disc brakes in 1971. Early models are recognisable by small rear lights, while those from 1972 got larger rear lamps and flared wheel-arches. Production would ultimately move to Brazil where they continued to be built until 2013.

#### The Show Car

Bay window T2s make great vans and campers, so I was really happy that we got one onto *Wheeler Dealers* in Series 7. The bodywork was a bit rusty in places, so ours needed a new door and tailgate, and the white paintwork was quite tatty. So a respray in a superb metallic orange really lifted the whole look, especially when matched with new exterior trim and wheels. The T2 also got a bigger engine that I fitted with lots of new and upgraded parts, including new manifolds and twin carburettors, so it went much better, too. Finishing it all off was a refurbished interior that got new interior panels and carpets, plus the seats that I had left over from the Ford Sierra Cosworth. There's just so much you can do with these to improve them, and ours turned out brilliantly.

#### **Corrosion Hotspots**

- 1. Lower front panel and inner front valance
- 2. Roof gutters
- 3. Front screen surround
- 4. Chassis legs front to rear, including outriggers and jacking points
- 5. Floorpan
- 6. Door bottoms
- 7. Bottom of the tailgate/engine lid
- 8. Inner and outer wheel arches
- 9. Seat belt mounting points
- 10. Inner and outer sills
- 11. Around the side windows
- Rear corner of the engine bay, including the battery tray
- 13. Rear inner and outer lower valance







### The CheckList

The lower six inches of bodywork very carefully. It's here where most of the corrosion strikes a Bay Window, and bubbling on the surface could be a sign of much worse things underneath		The suspension for wear and signs of corrosion around the mounting points. The latter can affect the torsion bars and shock absorber mounts, and will be costly to rectify if it's gone too far
That the chassis, floorpan, or sills aren't crusty and showing signs of previous patching. Sorting a bad one will be time consuming and very costly, so don't rush the checks here		The condition of the cabin. It's very simple, so wear and tear will be easy to spot, but budget accordingly if a refresh is on the cards. Re-trimming isn't difficult and all the parts are available  That any camper conversions have been done
The sliding side door operates smoothly. It could just need lubricating but runners and bushes can wear, leading to rattles		
For a tired and overworked air-cooled engine. A small amount of smoke on start-up is fine, but anything worse points to worn valve guides, piston rings, or cylinder bores and you're looking		properly. Condition can vary widely, so it pays to spend time checking fixtures and fittings. And remember to check the condition and operation of the elevating roof if fitted - it's often forgotter
at a major overhaul. And don't forget to check for excessive movement at the crank pulley		That all the electrics are working. A 'Bay' has little in the way of equipment or complication, but aged wiring or connections can cause
That the cooling system is healthy. Check the condition of the fan and belt, and watch for signs of overheating on the test drive		niggling faults which can be a pain to fix
The gearbox for any odd noises or an obstructive shift. Synchromesh wear is the most likely issue, but a reconditioned 'box can be found at a reasonable price. Ensure there's no judder or slippage from the clutch, either		
That it pulls up evenly under braking, and with a good pedal feel. They could have partially seized through lack of use, and later models were fitted with a servo that can suffer from perished and leaking pipework		
For excessive play in the steering. The 'Bay' can suffer from worn steering joints and wear in the idler arm, though neither issue is expensive to remedy		